

Work Order ID 69220

Thursday, May 05, 2011 11:45:21 AM

Page 1

Item ID: D3391-023

Accept

Revision ID:

Item Name: Mid Tube Assembly

Start Date: 5/5/2011 Start Qty: 1.00

Required Date: 5/20/2011 Req'd Qty: 1.00

Cust Item ID:

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Run

Start

Stop

Sequence ID
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

Draw Nbr

Revision Nbr

D3391

Rev H

100

0.00



Skid tubes

Skid tubes

Skid tubes

Memo

0.00

1-Cut tube to finish length as per Dwg D3391

2-Identify as D3391-023

3-Drill pilot holes using DT8796 (Do not drill "B" holes) and drill only 1 fwd saddle hole on one side only as per Dwg D3391

4-Open saddles and GHW holes to Ø0.375" except for fwd saddle hole of detail "J"

5-Remove .030" from Fwd indexing Ridge as per Dwg D3391

6-Remove indexing ridge on Fwd & Aft end of skid tube as per Dwg D3391

7-Deburr

8-Drill #30 pilot holes using wearplate Jig DT8217 Identify Ø0.250" holes with paint marker,

9-Open wearplate holes of D3391-023 assembly detail section G-G to Ø0.250" (14 holes) as per Dwg D3391 and 2 holes in section Detail "J"; do not open wearplate holes of section "J"

10-Open wearplate holes of D3391-023 assembly detail section H-H to Ø0.297" (20 holes) as per Dwg D3391

1 0 BE14/05/16

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr.	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 69220

Thursday, May 05, 2011 11:45:21 AM



Page 2

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 5/5/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 5/20/2011 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

11-Open .375" holes to .438" ***do not open fwd saddle holes***

BE 11/05/11

12-Locate D3391-021 in D3391-023 at 9.00" (see view z-z)

13- Transfer drill one fwd saddle hole only to .188" dia, transfer drill all remaining fwd saddle holes using DT 8149 locating from previously drill .188" dia hole, using t-pins and clicos to ensure perfect allingment, open up previously tranfer drilled pilot holes in D3391-023/-021 to 0.438" dia. in D3391-021

14- Transfer drill 2 wearplate holes into D3391-021 using DT8217, locating from two previously drilled holes, drill remaining wearplate holes into D3391-021.

15- Locating from two fwd wearplate holes drill remaining 6 wearplate holes in D3391-021 using DT8937

DP 11-5-16

16- Open 2 fwd wearplate holes in D3391-023 to .250" dia.

17- counterbore two aft wearplate holes in D3391-021 as per dwg

18- Open 12 wearplate holes in D3391-021 to 0.297" dia.

19-Deburr and blow out all chips from inside tube

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 69220

Thursday, May 05, 2011 11:45:21 AM

Page 3

Item ID: D3391-023

Accept

Revision ID:

Item Name: Mid Tube Assembly

Start Date: 5/5/2011 Start Qty: 1.00

Required Date: 5/20/2011 Req'd Qty: 1.00

Reference:

Cust Item ID:

Customer:

Approvals:

Process Plan:

Date:

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Run

Start

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

110

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

Quality Control

120

Chemical Conversion Coat per QSI005 4.1

0.00



HandFinish

Memo

0.00

Hand Finishing

130

QC3- Inspect Part Finish

0.00



QC

Memo

0.00

Quality Control



Setup Start



Stop



Run Start



Stop



8 ul 5/17

HL

1 of 11-5-17

DP 11-5-17

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 69220

Thursday, May 05, 2011 11:45:21 AM

Page 4

Item ID: D3391-023

Accept

Setup Start

Revision ID:

Stop

Item Name: Mid Tube Assembly

Start Date: 5/5/2011 Start Qty: 1.00

Cust Item ID:

Required Date: 5/20/2011 Req'd Qty: 1.00

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

140

0.00



Skidtubes

Skidtubes

Memo

0.00

Skidtubes

1-Open float bag holes as per dwg
2-C'sink float bag holes as per dwg
3- Prepare tube for welding
4-Bond web in place as per Dwg D3391 & QSI 015.
Adhere for 12 hours)
A/R Sikaflex exp: 12-1-15
batch#: M116948

11-5-17

150

QC5- Inspect part completeness to step on W/O

0.00



QC

Quality Control

Memo

0.00

1 0 BEU/05/18

160

0.00



Skidtubes

Skidtubes

Memo

0.00

Skidtubes

1-Weld crossbolt spacer as per dwg D3391 & QSI 004
2-grind weld flush

A/R M116577

1 0 BEU/05/18

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 69220

Thursday, May 05, 2011 11:45:21 AM

Page 5

Item ID: D3391-023

Accept

Setup Start

Revision ID:

Stop

Item Name: Mid Tube Assembly

Start Date: 5/5/2011 Start Qty: 1.00

Cust Item ID:

Required Date: 5/20/2011 Req'd Qty: 1.00

Customer:




Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
170  QC Quality Control	QC10- Inspect visual per QSI004- ground welds Memo	0.00 0.00							
180  QC Quality Control	QC5- Inspect part completeness to step on W/O Memo	0.00 0.00							
185  HandFinish Hand Finishing	Pressure Wash per QSI005 4.3 Memo AND REALODINE AS PER PAR09-043	0.00 0.00							

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 69220

Thursday, May 05, 2011 11:45:21 AM



Page 6

Item ID:	D3391-023	Accept		Setup	Start	
Revision ID:						
Item Name:	Mid Tube Assembly				Stop	
Start Date:	5/5/2011	Start Qty:	1.00			
Required Date:	5/20/2011	Req'd Qty:	1.00			
Reference:						

Approvals:	Process Plan:	Date:	Tooling:	Date:	Run	Start	
	QC:	Date:	SPC (Y/N):	Date:		Stop	

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
190 Powdercoat Powder Coating	White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum Memo M116 964. START TIME: 2:35 OVEN TEMPERATURE: 320° FINISH TIME: 3:05	0.00 0.00				1		BR 11-5-19	
200 QC Quality Control	QC3- Inspect Part Finish Memo	0.00 0.00				1	6	20 u/05/21	

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 69220

Thursday, May 05, 2011 11:45:21 AM



Page 7

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 5/5/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 5/20/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
210		0.00							
	Skidtubes								
Skidtubes	Memo	0.00							
Skidtubes	1- insert D3391-021 into D3391-23								
	2- insert T-pins into first and third fwd saddle holes								
	3- ON FIRST SIDE ONLY drill out 2nd and forth fwd saddles holes to 0.500" as per DSI 9364								
	4- remove T-pins and locate DT9415 from first and third crossbolt hole using T-pins and clekos								
	5- ON 2ND SIDE ONLY ream out 2nd and forth saddle hole to 0.499". Remove DT9415								
	6- deburr, re-alodine and blow out chips								
	7- press fit D3591-1 spacers using DT9416 starting from 0.500" side								
220	QC5- Inspect part completeness to step on W/O	0.00							
	QC	0.00							
Quality Control	Memo								

1 6 20 100/100

8/11/05/24

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____








NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries


Work Order ID 69220

Thursday, May 05, 2011 11:45:21 AM

Page 9

Item ID:	D3391-023	Accept		Setup	Start	
Revision ID:					Stop	
Item Name:	Mid Tube Assembly					
Start Date:	5/5/2011	Start Qty:	1.00		Cust Item ID:	
Required Date:	5/20/2011	Req'd Qty:	1.00		Customer:	
Reference:						
Approvals:	Process Plan:	Date:	Tooling:	Date:	Run	Start
	QC:	Date:	SPC (Y/N):	Date:		Stop
						
						

 Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
260	QC21- Final Inspection - Work Order Release	0.00							
									
QC	Memo	0.00							
Quality Control									

11/5/26 
MF
11-05-25

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Thursday, May 05, 2011 11:45:29 AM

Page 1

Work Order ID: 69220

Parent Item: D3391-023

Parent Item Name: Mid Tube Assembly



Start Date: 5/5/2011

Required Date: 5/20/2011

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP A 05.10.20 New Issue KJ/EC
 IPP B 06.02.10 ECN773 dwg rev.D EC
 IPP C 07.03.20 rev F dwg EC
 IPP D 07.03.28 re-format EC
 IPP E 07.10.31 ecn 1053P EC
 IPP Rev:F ECN 1056 07-11-13 DD verified by: EC
 IPP Rev:G 08-09-08 new process (ecn 08-510) DD verified by:EC
 IPP Rev:H 08-09-10 revH as per dwg DD verified by:EC
 IPP Rev: I 08-11-13 Removed steps per w/o, QC KJ verified by: ec IPP
 Rev:J add in seq 140 expire date &b# sikaflex DD 10.02.17 verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D2500-1-100		Manufactured	No			100	Each	95.0000	1	1			
Skidtube Extrusion													

Location	Loc Qty	Loc Code
HALL	95	
37065	13	
50251	82	

D3391-021		Manufactured	No			100	Each	0.0000	1	1			
Fwd Tube Assembly													
D3389-1		Manufactured	No				Each	2.0000	1	1			
Web													

Location	Loc Qty	Loc Code
LG	2	
68999	2	

B68657

①

DP 11-5-17

BE 11/05/16

① DP 11-5-16

140
B68667 11/05/16

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Thursday, May 05, 2011 11:45:29 AM

Page 2

Work Order ID: 69220

Parent Item: D3391-023

Parent Item Name: Mid Tube Assembly

Start Date: 5/5/2011

Required Date: 5/20/2011

Start Qty: 1.00

Required Qty: 1.00

D3681-1
Spacer
Manufactured No

160 Each

19.0000

5 5



BE 1/05/11

Location

Loc Qty

Loc Code

LG

19

68958

19

5

D3591-1
Bushing
Manufactured No

210 Each

55.0000

2 2



21 4/05/11

Location

Loc Qty

Loc Code

ST068

55

57350

18

66147

37

12

ALS4-1032-130
Insert
Purchased No

230 Each

1,338.000

20 20



21 4/05/11

Location

Loc Qty

Loc Code

ST281

1338

117331

1338

120

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

SHOP COPY

RETURN TO 1

ENGINEERING
UNCONTROLLED COPY

SUBJECT TO AMENDMENT

WITHOUT NOTICE

WORK ORDER

NO. 09220

D3391-015
AFT TUBE ASSEMBLYSEAL WITH SIKAFLEX-241/-291
PRIOR TO INSTALLATION OF
WEARSHOESMS27039C4-12 SCREW
D3672-3 WASHER
AN960C416L WASHER
4 PLD3391-013
MID TUBE ASSEMBLYTRANSFER DRILL THRU
D3391-011 OPEN TO
 ± 0.005
 $\emptyset 0.438 \pm 0.000$ TRANSFER DRILL THRU
D3391-011 OPEN TO $\emptyset 0.499$
AND INSTALL D3591-1 BUSHINGD3391-011
ASSEMBLYL WITH SIKAFLEX-241/-291
PRIOR TO INSTALLATION OF
WEARSHOESD3553-3
GASKET
REF
D3537-7
WEARPAD
REFD3553-1
GASKET
REFD3537-1
WEARPAD
REF

DEO ATTACHED

RELEASED
05-09-05D3566-13 GASKET
REF
D3564-13
WEARSHOE
REF

D3566-1 GASKET

D3566-5 GASKET

D3566-1
GASKETD3564-3
WEARSHOEAN3C6A BOLT
AN960C10L WASHER
4 PLAN3C7A BOLT
AN960C10L WASHER
8 PLAN3C4A BOLT (1)
AN960C10L WASHER (1)
20 PLAN3C6A BOLT
AN960C10L WASHER
6 PLAN3C6A BOLT (1)
AN960C10L WASHER (1)
2 PLD3564-1
WEARSHOE
D3564-5
WEARSHOE**D3391-041 ASSEMBLY****D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST**

QTY	PART NUMBER	DESCRIPTION
1	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
1	D3566-5	GASKET
2	D3591-1	BUSHING
4	D3672-3	WASHER
24	AN3C4A	BOLT
12	AN3C6A	BOLT
8	AN3C7A	BOLT
44	AN960C10L	WASHER
4	MS27039C4-12	SCREW
4	AN960C416L	WASHER

GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH
AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH
LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS
OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL $\emptyset 0.297$ SIZE HOLES
FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT
WHERE INDICATED.

H	DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL ADDED D3591-1 BUSHING. ZN C6 $\emptyset 0.438$ DIM WAS 4 PL. ADDED $\emptyset 0.499$ DIM AND D3591-1 BUSHING. SHT 2 PL ADDED D3591-1 BUSHING. ZN C6 $\emptyset 0.438$ DIM WAS 4 PL. ADDED $\emptyset 0.499$ DIM AND D3591-1 BUSHING. (FOR FURTHER INFO SEE DSI 9364 & NCR 08-074)	AJS	08.08.20
G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV.	DESCRIPTION	BY	DATE
DESIGN	PH		
DRAWN	AJS		
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	08.08.20		
DART AEROSPACE USA, INC PORT HADLOCK, WA DRAWING NO. D3391 412 FLOAT SKIDTUBE REV. H SHEET 1 OF 8 SCALE NTS <small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR REPRODUCED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>			


W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

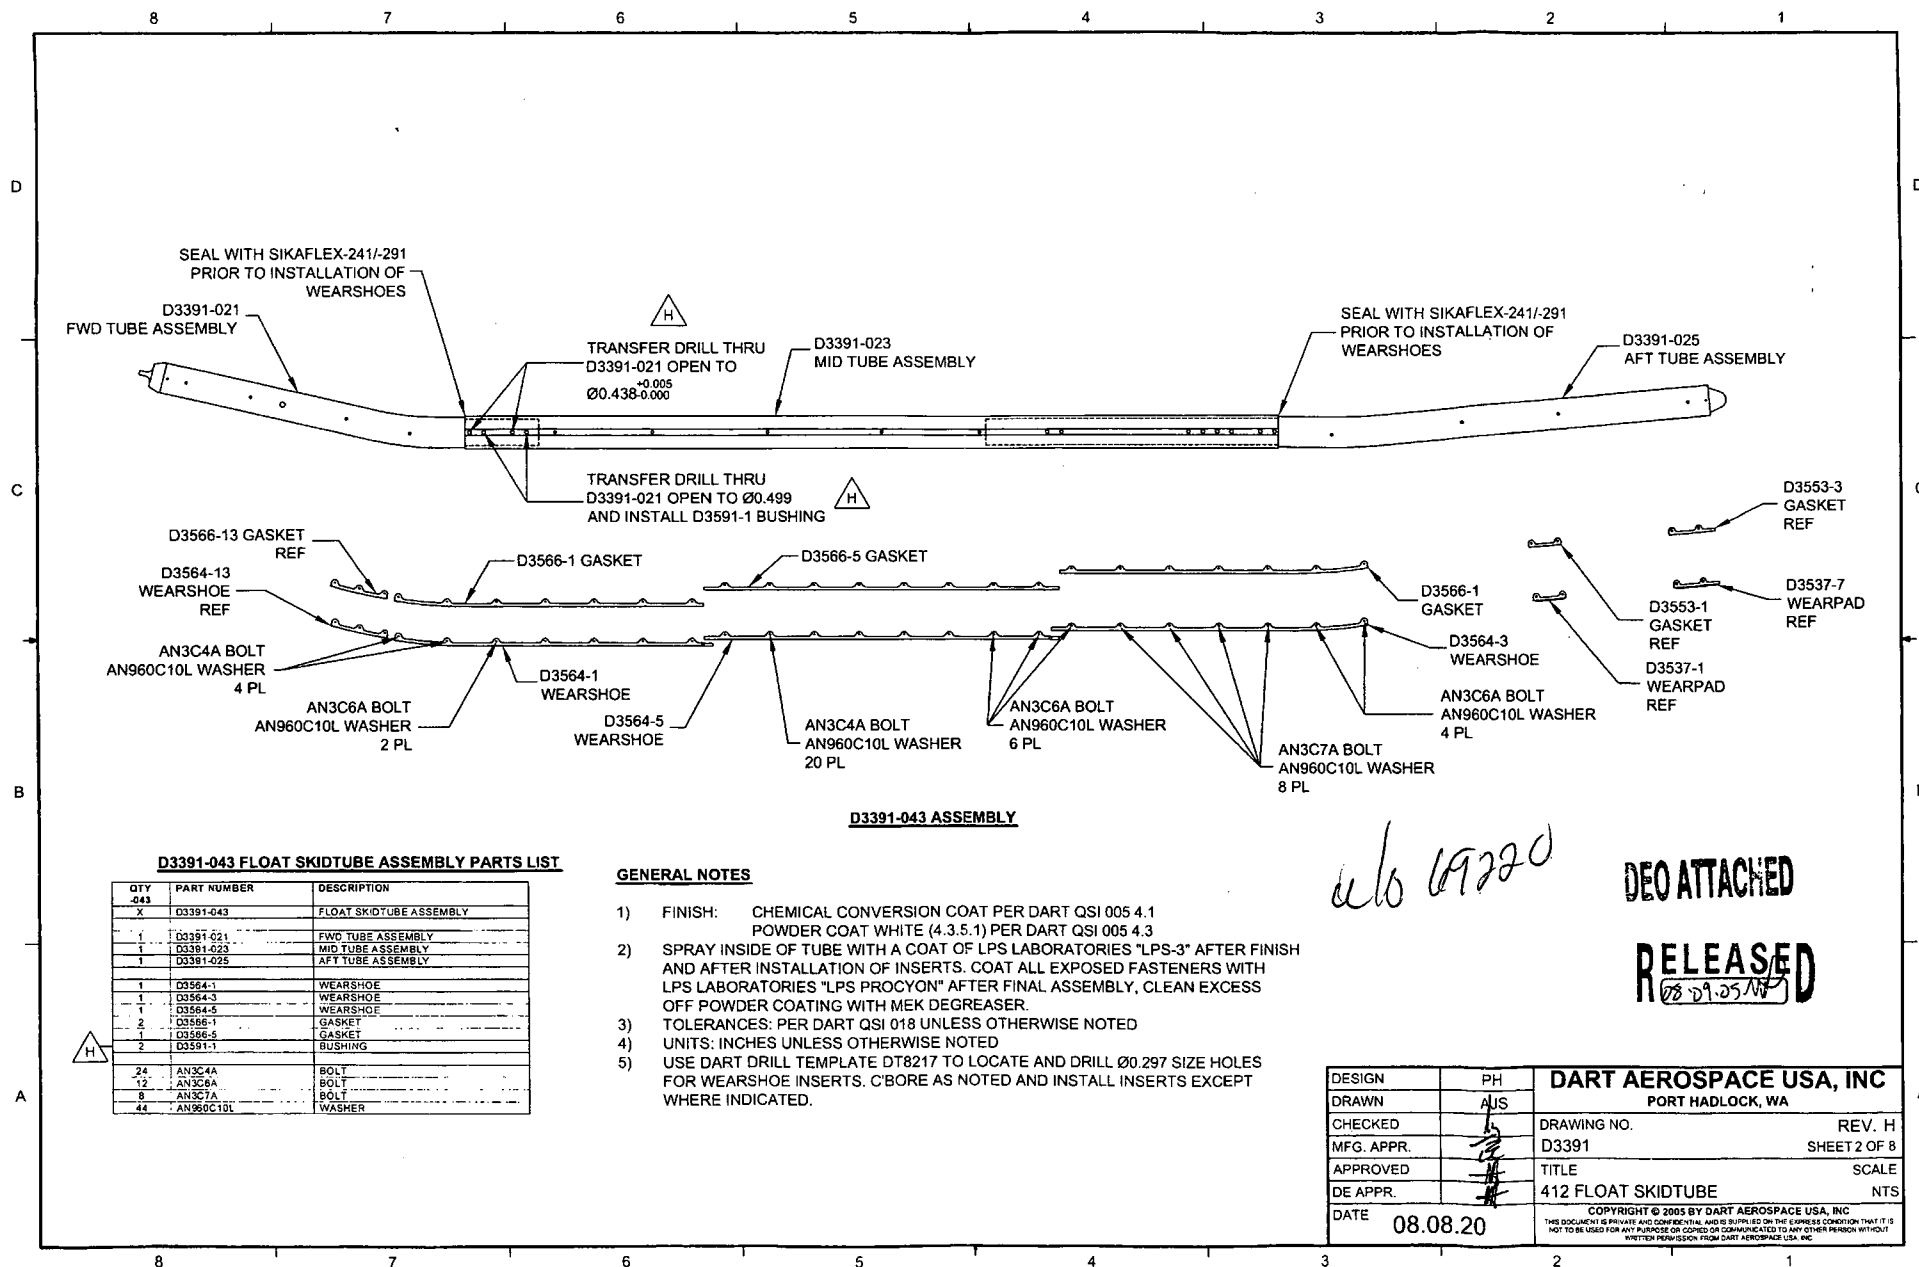


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

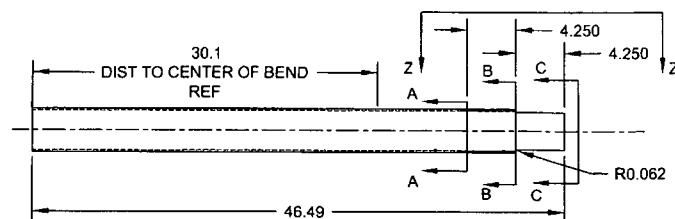


D3391-1 CUTTING DETAIL
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

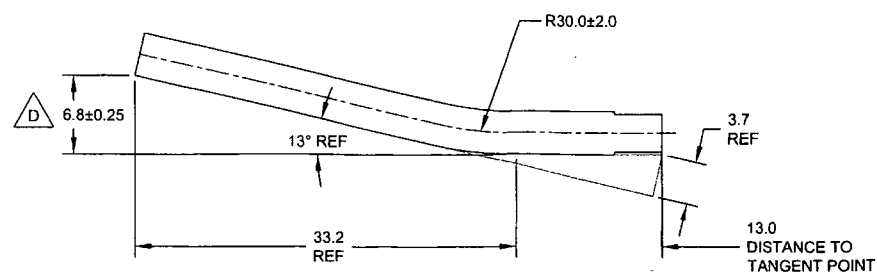


D3391-011/-021 BENDING DETAIL
(MAKE FROM D3391-1)

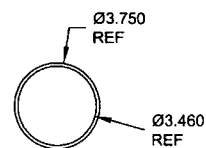


SECTION A-A
SCALE 2X

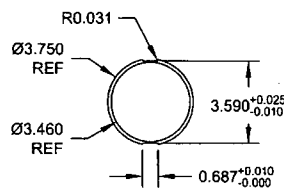

SECTION B-B
SCALE 2X

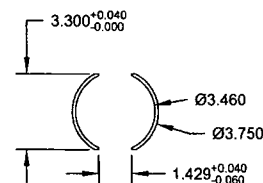

SECTION C-C
SCALE 2X

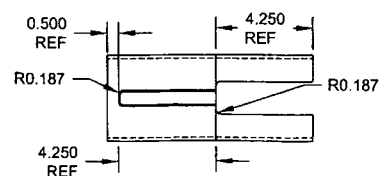

VIEW Z-Z
SCALE 2X

DEO ATTACHED
RELEASED
08-05-11

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 3 OF 8
APPROVED	JAN	TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


8 7 6 5 4 3 2 1

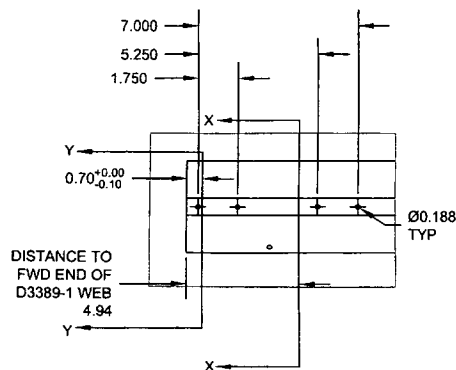

DETAIL J
SCALE 4X

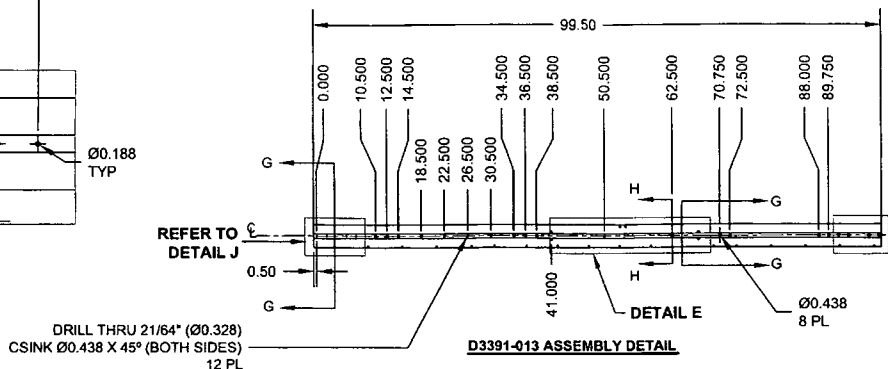


D3391-013 ASSEMBLY DETAIL

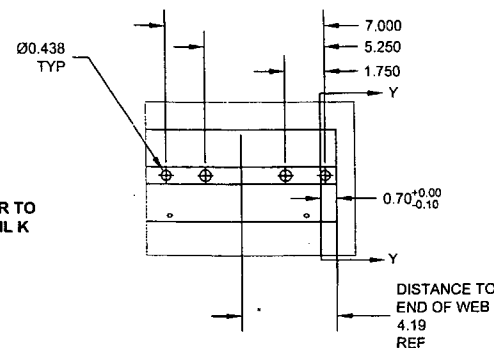


DETAIL K
SCALE 4X




SECTION G-G
SCALE 5X

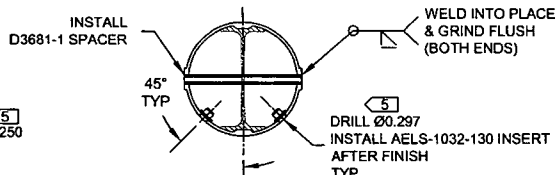

SECTION H-H
SCALE 5X

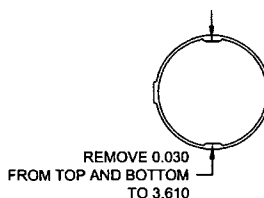


SECTION X-X
SCALE 5X

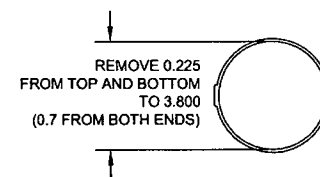


SECTION Y-Y
SCALE 5X

D3391-013 MID TUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
-013		
X	D3391-013	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
4	D3672-1	WASHER
4	D3672-3	WASHER
12	D3681-1	SPACER
24	AELS-1032-130	INSERT
4	ALS4-428-165	INSERT
4	AN960C10L	WASHER
4	AN960C416L	WASHER
4	MS27039C1-09	SCREW
4	MS27039C4-08	SCREW

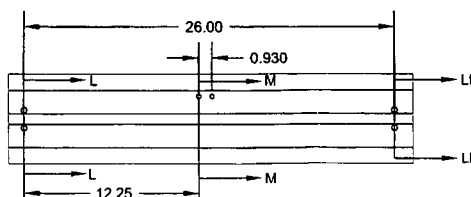


DETAIL E
SCALE NONE

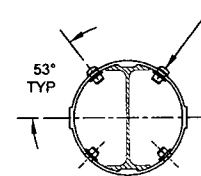

SECTION M-M
SCALE 5X


DRILL Ø0.297
INSTALL AELS-1032-130 INSERT
MS27039C1-09 SCREW
D3672-1 WASHER
AN960C10L WASHER
AFTER FINISH
4 PL

DRILL Ø0.250
4 PL

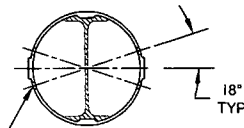

SECTION LL-LL
SCALE 5X

DRILL Ø0.391
INSTALL ALS4-428-165 INSERT
MS27039C4-08 SCREW
D3672-3 WASHER
AN960C416L WASHER
AFTER FINISH
4 PL

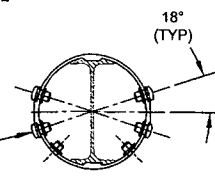

SECTION L-L
SCALE 5X

D3391-013 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/-291 PER QSI 015
- 3) WELDING: PER DART QSI 004

DEO ATTACHED

RELEASED

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AIS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG APPR.		D3391	SHEET 5 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC


W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

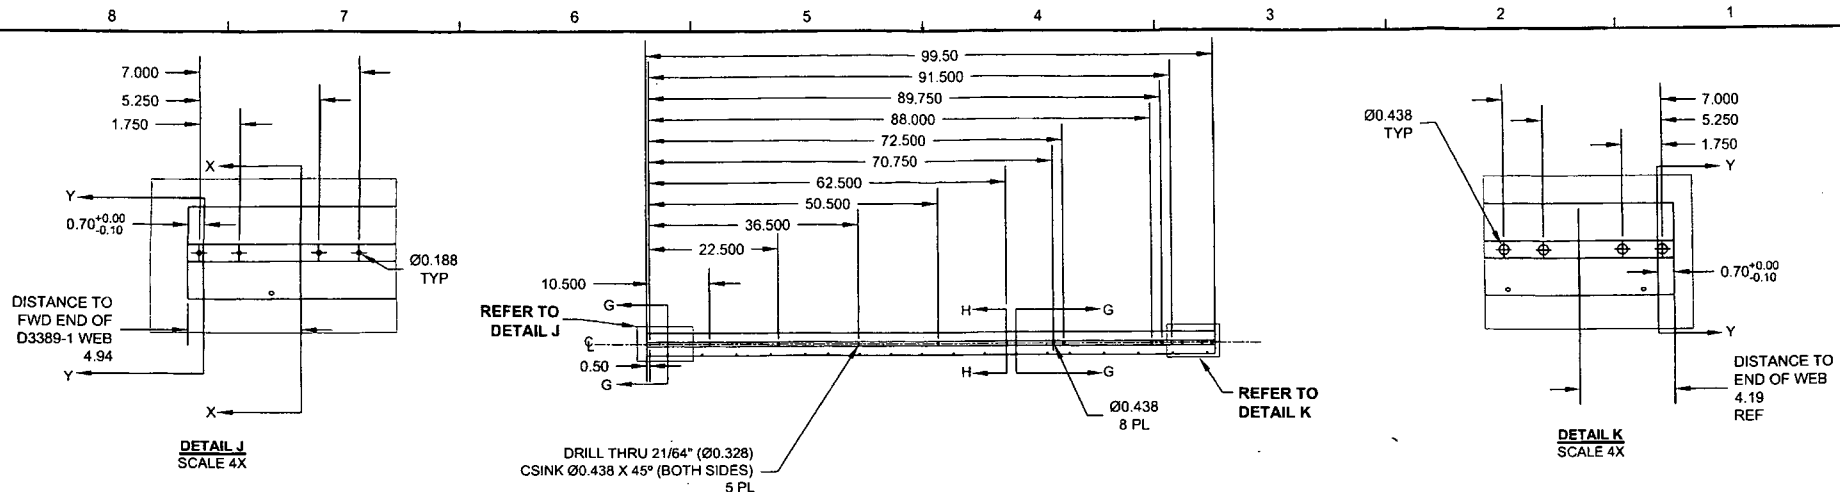


SECTION G-G
SCALE 5X

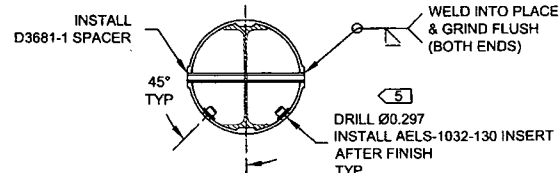

SECTION H-H
SCALE 5X

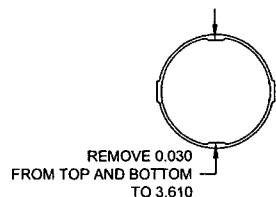

SECTION X-X
SCALE 5X

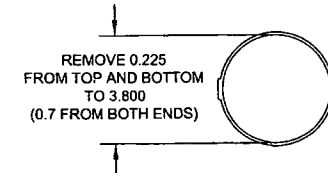

SECTION Y-Y
SCALE 5X

D3391-023 MID TUBE ASSEMBLY PARTS LIST

QTY - 023	PART NUMBER	DESCRIPTION
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT

- D3391-023 MID TUBE ASSEMBLY**
- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
 - 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/-291 PER QSI 015
 - 3) WELDING: PER DART QSI 004

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AS	PORT HADLOCK, WA	
CHECKED	AS	DRAWING NO.	REV. H
MFG. APPR.	AS	D3391	SHEET 6 OF 8
APPROVED	AS	TITLE	SCALE
DE APPR.	AS	412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	

DEO ATTACHED
RELEASED
08-09-05 JV

u/c 69220


W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

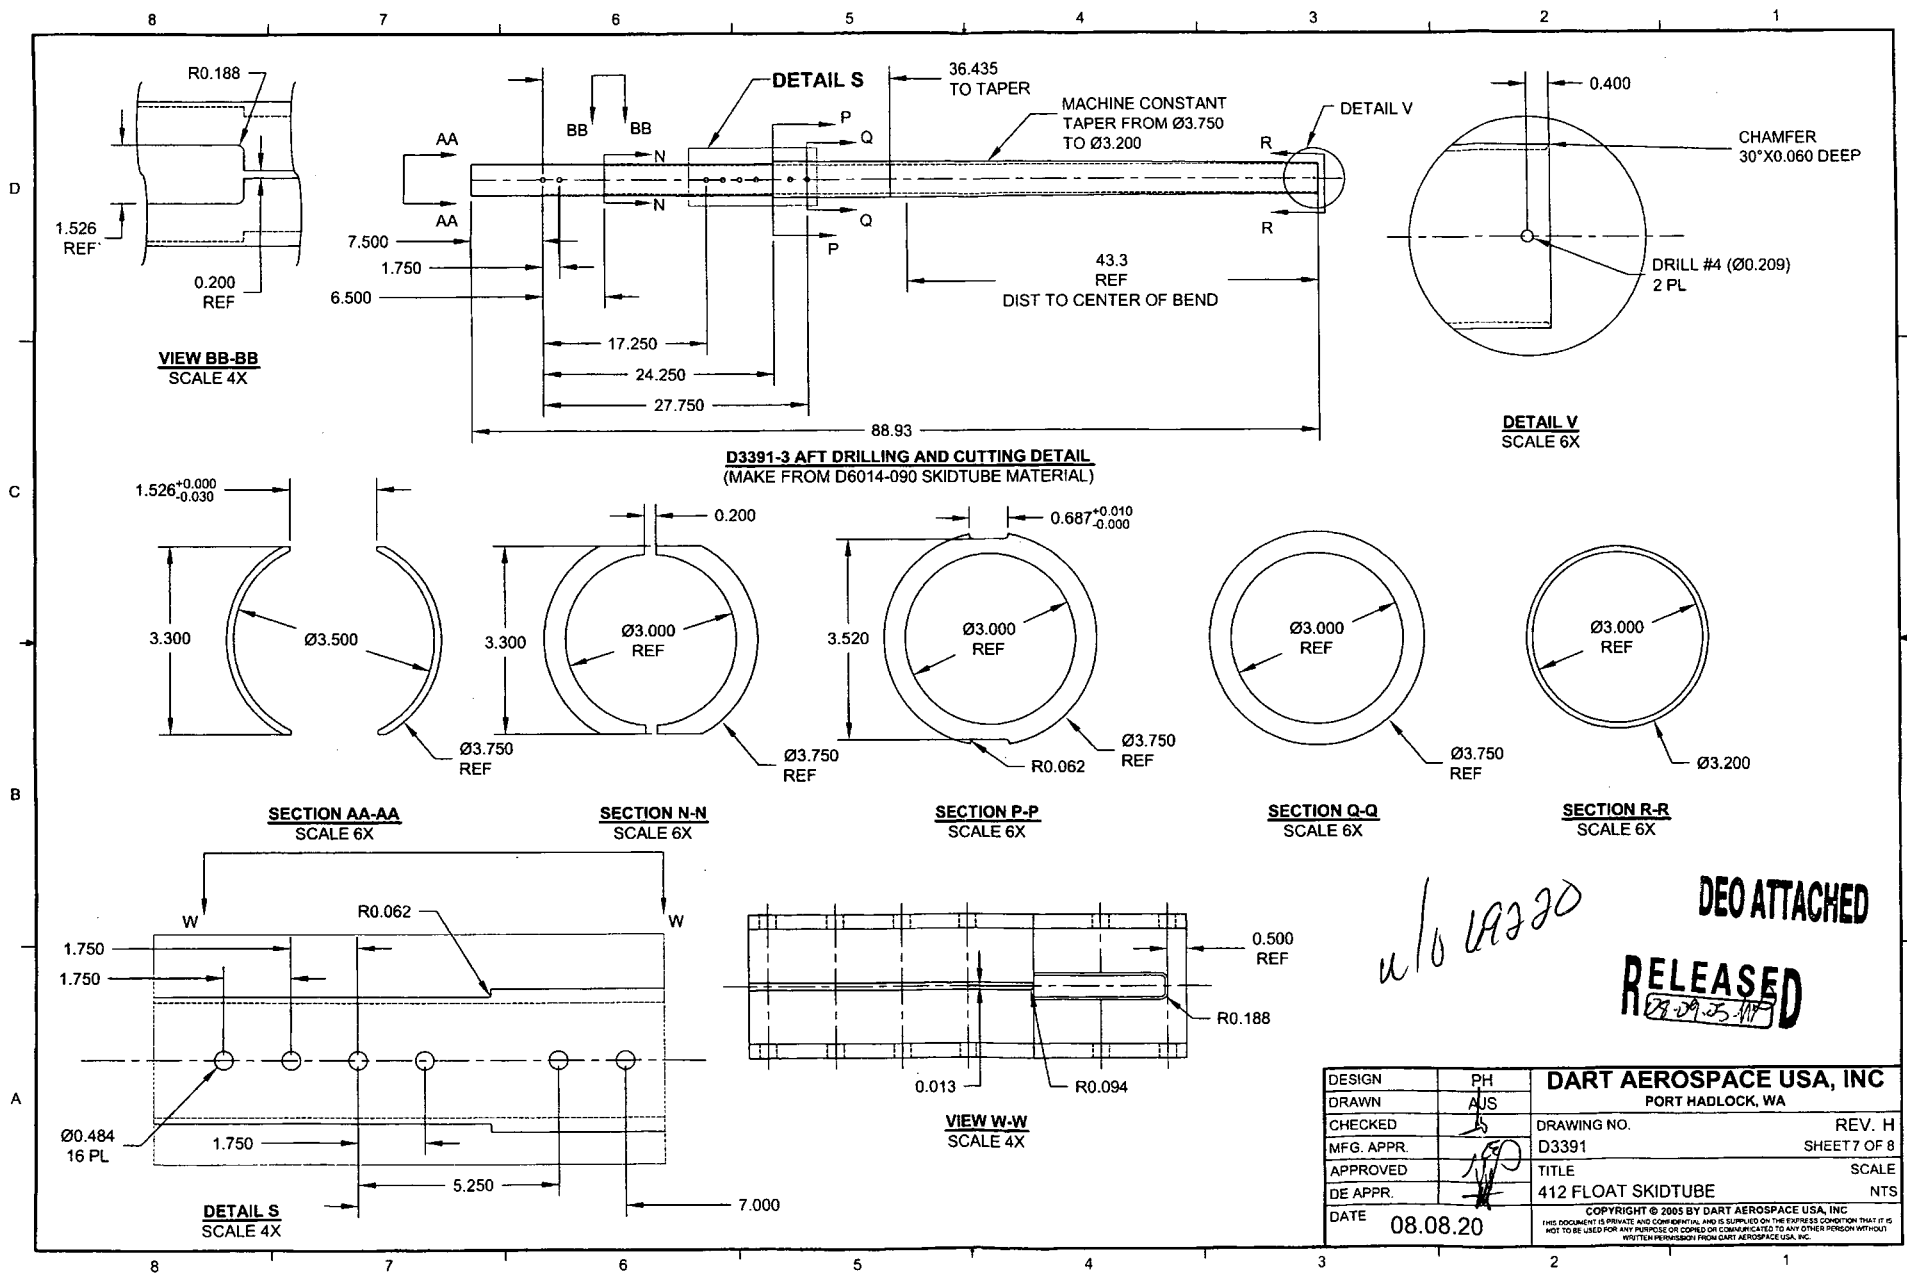


W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

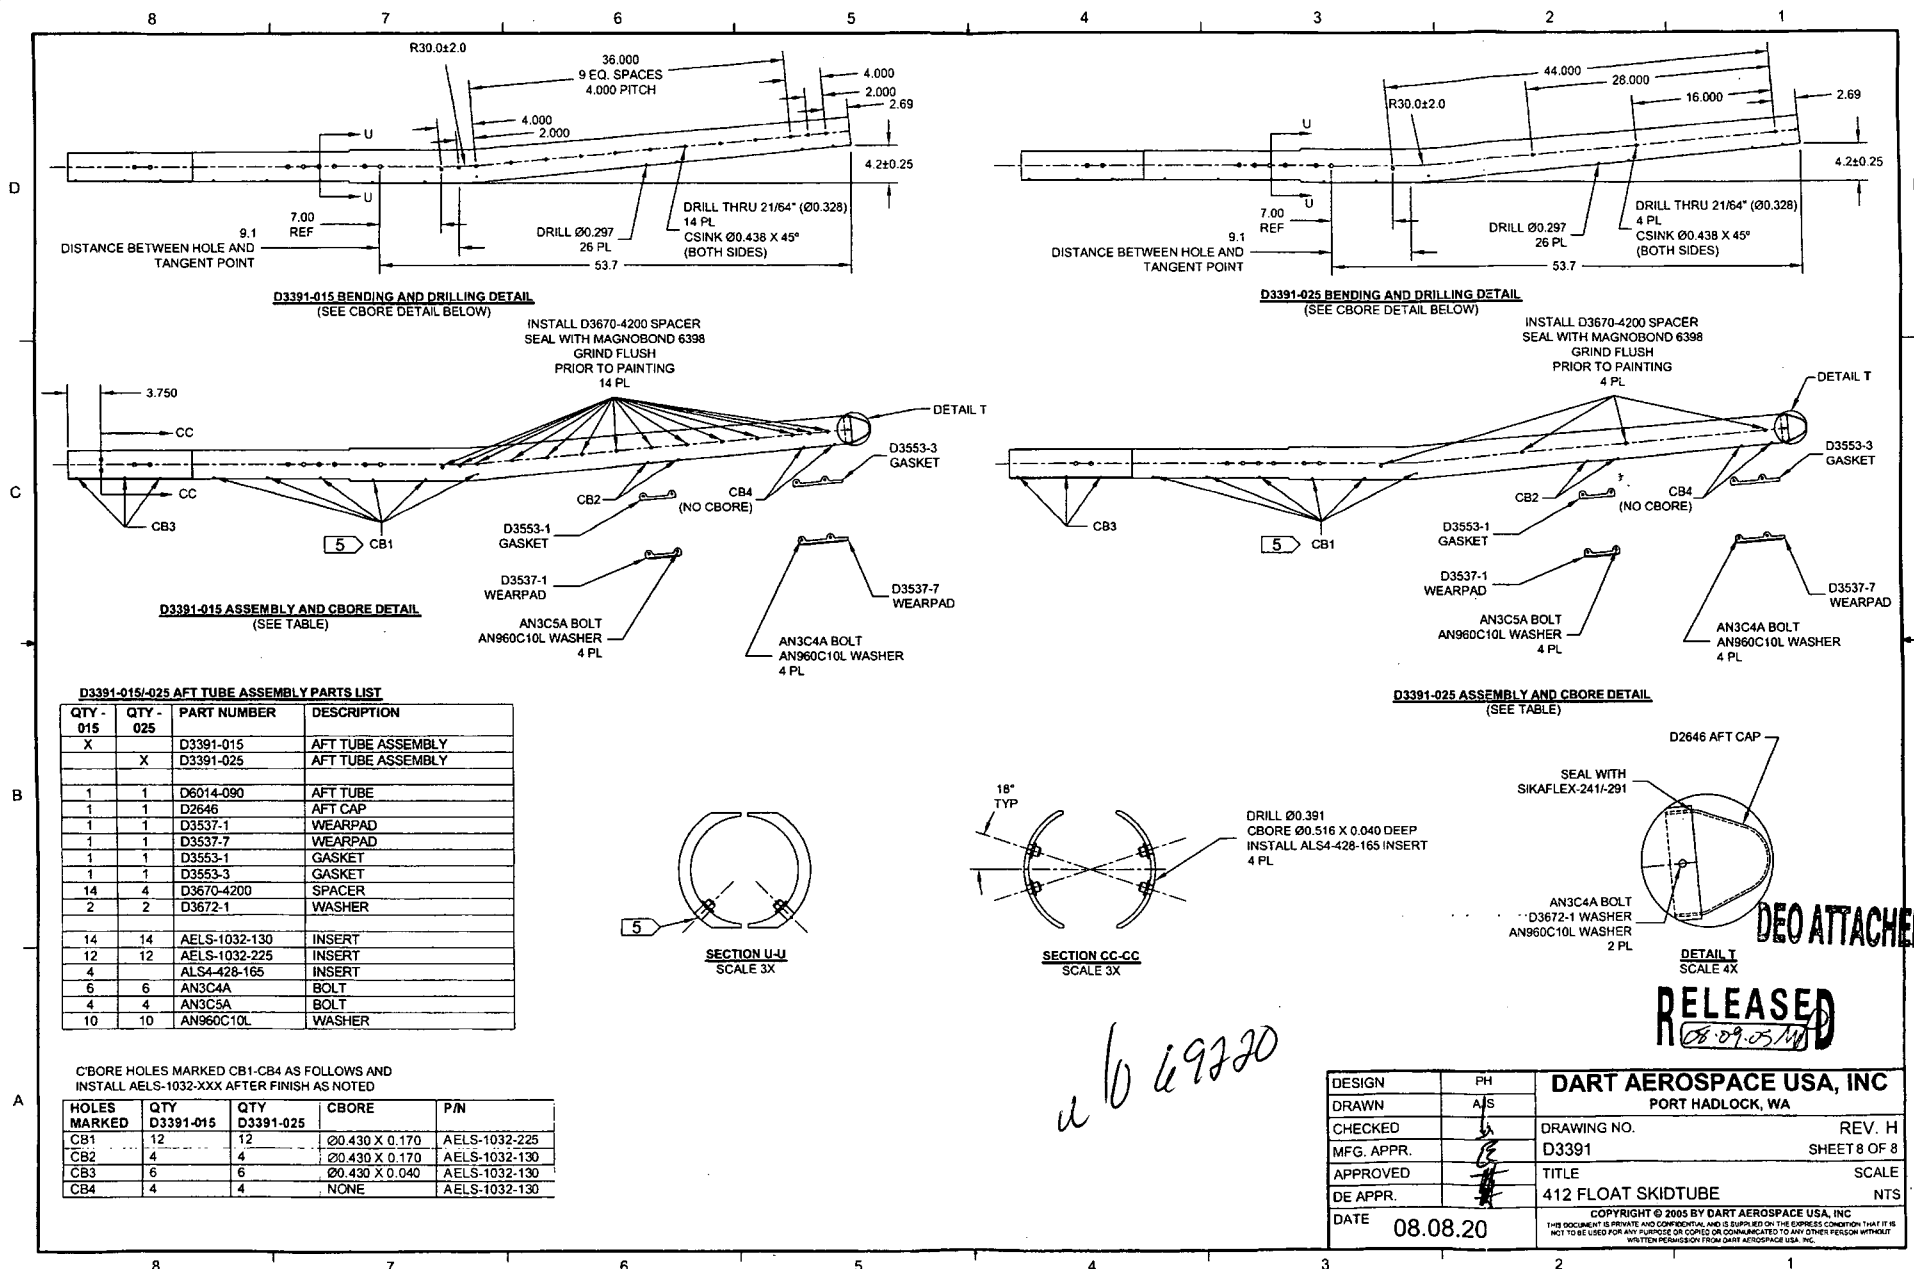

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DRAWING NO. D3391	TITLE 412 FLOAT SKIDTUBE	REV. H	DART AEROSPACE USA, INC ENGINEERING ORDER		D.E.O. NO. D3391-H-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>JP</i>	CHECKED <i>L</i>	MFG. APPR. <i>MS</i>	APPROVED <i>MP</i>		DE APPR. <i>MP</i>		
DATE 09.09.23	DATE 04.09.24	DATE 09/09/25	DATE 09/09/30		DATE 09/09/30		

PURPOSE:

LPS-3 IS NO LONGER USED DURING ASSEMBLY OF D3391-041/-043 SKIDTUBES.

CHANGE:

AMEND NOTE 2 OF D3391-041/-043 SKIDTUBE ASSEMBLIES (ZN A6-1, A6-2) AS FOLLOWS:

- 2) ~~SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH~~
~~AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH~~
 LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS
 OFF POWDER COATING WITH MEK DEGREASER.

RELEASED
 2010-02-02

MP

u/b 69220

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

NO. 7250

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name: Barclay Elliott
Job number: 62679
Part number: D3391 - 023
Description: 3391
Welding Process: Tig[☒] Mig[]
Base material: _____
Current: AC[☒] DC[]

TEST REQUIREMENTS AND RESULTS

Visual: pass[☒] fail[]
Penetration: pass[☒] fail[]

UNACCEPTABLE

Cracks: pass[☒] fail[]
Undercut: pass[☒] fail[]
Pin holes: pass[☒] fail[]
Overlap (cold lap): pass[☒] fail[]
Porosity (surface): pass[☒] fail[]
Coloration: pass[☒] fail[]

Qualifier J. H. W. N. S. Date of Test Coupon 11-04-28
Welder Barclay Elliott Date of Test Coupon 11-04-28

The above named individual is qualified in accordance with AWS D17.1.2001 to weld